Technical tips



large area neoprene/cork material supplied from clubs tends to distort badly

TAPPET COVER SANDWICH

Modification to stop oil leaks round the rocker cover




The original pressed steel tappet cover provided a possible source for oil leaks. Many Austin Seven owner have converted to a cast aluminium cover available from most clubs and Austin Seven specialists. Users of this modification should pay special attention to the type of flat gasket that is used with the new cover design. I have found that the current large area

neoprene/cork material supplied from clubs tends to distort badly and could cause long term problems. This can be overcome by using a thin aluminium sheet as a baffle and a thinner neoprene/cork seal to provide the seal. Loctite 515 was used to seal the aluminium cover to the aluminium baffle.

Bruce White

(Information obtained from the website of the Austin Seven Register of Queensland)



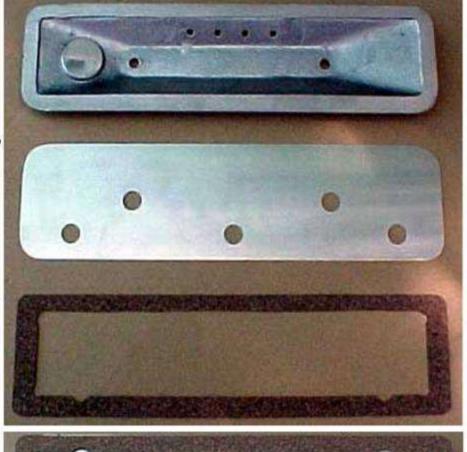

Wheels and tyres

What do we know about wheels and tyres other than the fact that most cars have them at each corner? A closer study will show a number of interesting facts of which some owners might not be fully aware.